

ACS POST-DEPARTURE MODING CONFIGURATION

1. DISABLE APAS LED MODE INDICATION AND VERIFY LED STATUS

NOTE

The functions in this section are to occur following the end of the Orbiter Prox-Ops phase.

PCS

ACS Moding

ACS Moding

'ACS Configuration'

sel LED Control SW Primary NCS - Command

cmd Inhibit **Execute**

√LED Control SW Primary NCS - Inh

√PMA2 LED State Primary NCS - Off

sel LED Control SW Secondary NCS - Command

cmd Inhibit **Execute**

√LED Control SW Secondary NCS - Inh

√PMA2 LED State Secondary NCS - Off

2. DISABLE DEPARTURE RESPONSE

'Departure'

sel PMA2 Departure Response SW Primary NCS - Command

cmd Inhibit **Execute**

√PMA2 Departure Response SW Arm Primary NCS - Blank

√PMA2 Departure Response SW Primary NCS - Inh

sel PMA2 Departure Response SW Secondary NCS - Command

cmd Inhibit **Execute**

√PMA2 Departure Response SW Arm Secondary NCS - Blank

√PMA2 Departure Response SW Secondary NCS - Inh

√Departure Event Primary, Secondary NCS - Blank